



Source Water Assessment

A Hydrogeologic Susceptibility and Vulnerability Assessment for Pacifica House & Diane's Restaurant Drinking Water System, Bethel, Alaska

> PWSID # 271982.001 February 2004

DRINKING WATER PROTECTION PROGRAM REPORT 1226 Alaska Department of Environmental Conservation

Source Water Assessment for Pacifica House & Diane's Restaurant Drinking Water System Bethel, Alaska

PWSID # 271982.001

DRINKING WATER PROTECTION PROGRAM REPORT 1226

The Drinking Water Protection Program (DWPP) is producing Source Water Assessments in compliance with the Safe Drinking Water Act Amendments of 1996. Each assessment includes a delineation of the source water area, an inventory of potential and existing contaminant sources that may impact the water, a risk ranking for each of these contaminants, and an evaluation of the potential vulnerability of these drinking water sources.

These assessments are intended to provide public water systems owners/operators, communities, and local governments with the best available information that may be used to protect the quality of their drinking water. The assessments combine information obtained from various sources, including the U.S. Environmental Protection Agency, Alaska Department of Environmental Conservation (ADEC), public water system owners/operators, and other public information sources. The results of this assessment are subject to change if additional data becomes available. It is anticipated this assessment will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of public drinking water source. If you have any additional information that may affect the results of this assessment, please contact the Program Coordinator of DWPP, (907) 269-7521.

CONTENTS

| EXECUTIVE SUMMARY1 PACIFICA HOUSE & DIANE'S RESTAURANT PUBLIC DRINKING WATER SYSTEM1 PACIFICA HOUSE & DIANE'S RESTAURANT | INVENTORY OF POTENTIAL AND EXISTING CONTAMINANT SOURCES | | | | |
|--|--|--|--|--|--|
| DRINKING WATER PROTECTION AREA2 | VULNERABILITY OF PACIFICA HOUSE & DIANE'S RESTAURANT DRINKING WATER SYSTEM3 | | | | |
| TABI | LES | | | | |
| Table 1. Definition of Zones | 3 | | | | |
| APPEN | DICES | | | | |
| APPENDIX A. Pacifica House & Diane's Restaurant | t Drinking Water Protection Area (Map A) | | | | |
| Contaminant Source Inventory and R Bacteria and Viruses (Table 2) Contaminant Source Inventory and R Nitrates/Nitrites (Table 3) | cifica House & Diane's Restaurant (Table 1) isk Ranking for Pacifica House & Diane's Restaurant – isk Ranking for Pacifica House & Diane's Restaurant – isk Ranking for Pacifica House & Diane's Restaurant – ble 4) | | | | |
| C. Pacifica House & Diane's Restauran and Existing Contaminant Source | t Drinking Water Protection Area and Potential es (Map C) | | | | |
| | ant Source Inventory and Risk Ranking for urant Public Drinking Water Source (Charts 1 – 8) | | | | |

Source Water Assessment for Pacifica House & Diane's Restaurant Source of Public Drinking Water, Bethel, Alaska

Drinking Water Protection Program Alaska Department of Environmental Conservation

EXECUTIVE SUMMARY

Pacifica House & Diane's Restaurant has one Public Water System (PWS) well. The well (PWSID# 271982.001) has been used as a drinking water source since it was drilled in 1993.

The well is a Class B (transient/non-community) water system located off the Chief Eddie Hoffman Highway in Bethel, Alaska. Available records indicate that there are two secondary storage tanks, with a combined capacity of 1,900-gallons, and that the drinking water is treated with calcium hypochlorite. This system operates year-round and serves 8 residents and approximately 54 non-residents through six service connections. The wellhead received a susceptibility rating of **Low** and the aquifer received a susceptibility rating of **Low**. Combining these two ratings produce a **Low** rating for the natural susceptibility of the well.

Identified potential and current sources of contaminants for the primary public drinking water source include: domestic wastewater collection systems, aboveground fuel tanks, wastewater holding tanks, water supply wells, glycol storage, airports, underground fuel tanks, a landfill, and Alaska Department of Environmental Conservation (ADEC) recognized contaminated sites and leaking underground storage tank (LUST) sites. These identified potential and existing sources of contamination are considered as sources of bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals. Overall, the water well received a vulnerability rating of Low for the bacteria and viruses, and nitrates and nitrites, and a vulnerability rating of **Medium** for volatile organic chemicals contaminant categories.

PACIFICA HOUSE & DIANE'S RESTAURANT PUBLIC DRINKING WATER SYSTEM

The Pacifica House & Diane's Restaurant well is a Class B public water system. The system consists of one well located off Chief Eddie Hoffman Highway in Bethel, Alaska (Sec. 18, T8N, R71W, Seward Meridian; see Map A of Appendix A). Bethel serves as the regional center for 56 villages in the Yukon-

Kuskokwim Delta. Food, fuel, transportation, medical care, and other services for the region are provided by Bethel. Bethel is located at the mouth of the Kuskokwim River, 40-miles inland from the Bering Sea, and approximately 400-air miles west of Anchorage. The community has a population of 5,736 (ADCED, 2003). Average annual precipitation for Bethel is 16 inches, including approximately 50 inches of snowfall. Temperatures range from 42 to 62°F in summer and -2 to 19°F in winter.

The community of Bethel obtains a portion of their water supply from city wells. Some households are served by the central piped water and sewage collection system; however, approximately 75% of households have water delivered and sewage hauled by truck. Several facilities have individual wells and septic tanks (ADCED, 2003). Bethel receives electrical power from the Bethel Utilities Corporation. Power generating facilities are fueled by diesel. Refuse is collected by the City of Bethel and transported to the City operated landfill (ADCED, 2003).

According to information supplied by ADEC for the Pacifica House & Diane's Restaurant PWS, depth of the water well is 425 feet below the ground surface (bgs). Based on available construction details, the well is screened in sand in a confined aquifer. The well is assumed to not be located in a floodplain.

Information acquired from a March 2003 sanitary survey for the public water system indicated that the land surface was sloped away from the well. Generally, land surfaces that slope away from the wellhead promote surface water drainage, which reduces potential of contaminant migration down the well casing annulus. The well is grouted according to ADEC regulations. Proper grouting provides added protection against contaminants traveling along the well casing annulus and into source waters.

The Bethel area is near the southern border of the continuous permafrost zone and the City, and most of the area west of the Kuskokwim River, appear to be underlain with permafrost. The permafrost generally extends to a depth of at least 300 feet bgs, with depths of over 600 feet bgs recorded in some areas. The geology in the area consists primarily of

unconsolidated floodplain alluvium, silt deposits, and reworked silt. The Bethel area consists of poorly drained wetlands that have permanently ponded water in local depressions. Sloughs, small lakes, ponds, and marshes in meander scars surround Bethel (Dames & Moore, 1996).

PACIFICA HOUSE & DIANE'S RESTAURANT DRINKING WATER PROTECTION AREA

In order to evaluate whether a drinking water source is at risk, we must first evaluate what are the most likely pathways for surface contamination to reach the groundwater. These areas are determined by looking at the characteristics of the soil, groundwater, aquifer, and well.

The most probable area for contamination to reach the drinking water well is the area that contributes water to the well, the groundwater recharge area. This area is designated as the drinking water protection area (DWPA). Because releases of contaminants within the protection area are most likely to impact the drinking water well, this area will serve as the focus for voluntary protection efforts. An analytical calculation was used to determine the size and shape of the DWPA for the Pacifica House & Diane's Restaurant PWS. The input parameters describing the attributes of the aquifer in this calculation were adopted from Groundwater (Freeze and Cherry, 1979). Available geology and groundwater contours were also considered to take into account any uncertainties in groundwater flow and aquifer characteristics to arrive at a meaningful protection area.

The protection areas established for wells by the ADEC are usually separated into four zones, limited by the watershed. These zones correspond to differences in the time-of-travel (TOT) of the water moving through the aquifer to the well (Please refer to the Guidance Manual for Class B Public Water Systems for additional information).

The time of travel for contaminants within the water varies and is dependent on the physical and chemical characteristics of each contaminant. The following is a summary of the four protection area zones for wells and the calculated time -of-travel for each:

Table 1. Definition of Zones

| Zone | Definition |
|------|---|
| A | ¹ / ₄ the distance for the 2-yr. time-of-travel |
| В | Less than the 2 year time-of-travel |
| C | Less Than the 5 year time-of-travel |
| D | Less than the 10 year time-of-travel |

The DWPA for the Pacifica House & Diane's Restaurant PWS was determined using an analytical calculation and includes Zone A, B, C, and D (See Map A of Appendix A).

INVENTORY OF POTENTIAL AND EXISTING CONTAMINANT SOURCES

The Drinking Water Protection Program has completed an inventory of potential and existing sources of contamination within the Pacifica House & Diane's Restaurant DWPA. This inventory was completed through a search of agency records and other publicly available information. Potential sources of contamination to the drinking water aquifer include a wide range of categories and types. Potential drinking water contaminants are found within agricultural, residential, commercial, and industrial areas, but can also occur within areas that have little or no development.

For the basis of all Class B public water system assessments, three categories of drinking water contaminants were inventoried. They include:

- Bacteria and viruses.
- Nitrates and/or nitrites,
- Volatile organic chemicals.

The sources are displayed on Map C of Appendix C and summarized in Table 1 of Appendix B.

RANKING OF CONTAMINANT RISKS

Once the potential and existing sources of contamination have been identified, they are assigned a ranking according to what type and level of risk they represent. Ranking of contaminant risks for a "potential" or "existing" source of contamination is a function of toxicity and volumes of specific contaminants associated with that source. Rankings include:

- Low,
- Medium,
- High, and
- Very High.

The time-of-travel for contaminants within the water varies and is dependent on the physical and chemical characteristics of each contaminant. Bacteria and Viruses are only inventoried in Zones A and B because of their short life span. Only "Very High" and "High" rankings are inventoried within the outer Zone D due to the probability of contaminant dilution by the time the contaminants get to the well.

Tables 2 through 4 in Appendix B contain the ranking of potential and existing sources of contamination with respect to bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals.

VULNERABILITY OF THE PACIFICA HOUSE & DIANE'S RESTAURANT DRINKING WATER SYSTEM

Vulnerability of a drinking water source to contamination is a combination of two factors:

- Natural susceptibility, and
- Contaminant risks.

Appendix D contains eight charts, which together form the 'Vulnerability Analysis' for a source water assessment for a public drinking water source. Chart 1 analyzes the 'Susceptibility of the Wellhead' to contamination by looking at the construction of the well and its surrounding area. Chart 2 analyzes the 'Susceptibility of the Aquifer' to contamination by looking at the naturally occurring attributes of the water source and influences on the groundwater system that might lead to contamination. Chart 3 analyzes 'Contaminant Risks' for the drinking water source with respect to bacteria and viruses. The 'Contaminant Risks' portion of the analysis considers potential sources of contaminants as well as a review of contamination that has or may have occurred, but has not arrived or been detected at the well. Lastly, Chart 4 contains the 'Vulnerability Analysis for Bacteria and Viruses'. Charts 5 through 8 contain the Contaminant Risks and Vulnerability Analyses for nitrates and nitrites and volatile organic chemicals, respectively.

A score for the Natural Susceptibility is reached by considering the properties of the well and the aquifer.

Susceptibility of the Wellhead (0 – 25 Points) (Chart 1 of Appendix D)

+

Susceptibility of the Aquifer (0 – 25 Points) (Chart 2 of Appendix D)

=

Natural Susceptibility (Susceptibility of the Well) (0-50 Points)

A ranking is assigned for the Natural Susceptibility according to the point score:

| Natural Susceptibility Ratings | | | | | | |
|--------------------------------|-----------|--|--|--|--|--|
| 40 to 50 pts | Very High | | | | | |
| 30 to < 40 pts | High | | | | | |
| 20 to < 30 pts | Medium | | | | | |
| < 20 pts | Low | | | | | |

The Pacifica House & Diane's Restaurant's water well is in a confined aquifer. Confined aquifers are less susceptible to potential groundwater quality impacts posed by the migration of surface water contaminants downward from the surface. Table 2 shows the Susceptibility scores and ratings for both wells in this PWS.

Table 2. Susceptibility

| | Score | Rating |
|------------------------|-------|--------|
| Susceptibility of the | 0 | Low |
| Wellhead | | |
| Susceptibility of the | 1 | Low |
| Aquifer | | |
| Natural Susceptibility | 1 | Low |

Contaminant risks to a drinking water source depend on the type, number or density, and distribution of contaminant sources. This score has been derived from an examination of existing and historical contamination that has been detected at the drinking water source through routine sampling. It also evaluates potential sources of contamination. Flow charts are used to assign a point score, and ratings are assigned in the same way as for the natural susceptibility:

| Contaminant Risk Ratings | | | | | | |
|--------------------------|-----------|--|--|--|--|--|
| 40 to 50 pts | Very High | | | | | |
| 30 to < 40 pts | High | | | | | |
| 20 to < 30 pts | Medium | | | | | |
| < 20 pts | Low | | | | | |

Table 3 summarizes the Contaminant Risks for each category of drinking water contaminants.

Table 3. Contaminant Risks

| Category | Score | Rating |
|---------------------------|-------|-----------|
| Bacteria and Viruses | 25 | Medium |
| Nitrates and/or Nitrites | 25 | Medium |
| Volatile Organic Chemical | s 47 | Very High |

Finally, an overall vulnerability score is assigned for each water system by combining each of the contaminant risk scores with the natural susceptibility score:

Natural Susceptibility
$$(0 - 50 \text{ points})$$

+

Contaminant Risks (0 - 50 points)

=

Vulnerability of the Drinking Water Source to Contamination (0-100).

Again, rankings are assigned according to a point score:

| Overall Vulnerability Ratings | | | | | | |
|-------------------------------|-----------|--|--|--|--|--|
| 80 to 100 pts | Very High | | | | | |
| 60 to < 80 pts | High | | | | | |
| 40 to < 60 pts | Medium | | | | | |
| < 40 pts | Low | | | | | |

Table 4 contains the overall vulnerability scores (0 – 100) and ratings for each of the three categories of drinking water contaminants. Note: scores are rounded off to the nearest five.

Table 4. Overall Vulnerability

| Category | Score | Rating |
|----------------------------|-------|--------|
| Bacteria and Viruses | 25 | Low |
| Nitrates and Nitrites | 25 | Low |
| Volatile Organic Chemicals | 50 | Medium |

Bacteria and Viruses

The contaminant risk for bacteria and viruses is **Low**. The risk is primarily attributed to the presence of a domestic wastewater collection system in Zone A (See Table 2 – Appendix B).

A positive bacteria count has not been reported in recent (within five years) sampling events. Only a small amount of bacteria and viruses are required to endanger public health.

After combining the contaminant risk for bacteria and viruses with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Low**.

Nitrates and Nitrites

The contaminant risk for nitrates and nitrites is **Low**. The risk to this source of public drinking water is attributed to the presence of a domestic wastewater collection system in Zone A (See Table 3 – Appendix B).

Nitrates are very mobile, moving at approximately the same rate as water. The sampling history for this well indicates that nitrates have not been detected in recent sampling events. Nitrate concentrations in uncontaminated groundwater are typically less than 2 mg/L; therefore, nitrate concentrations above 2 mg/L may be indicative of man-made sources (See Chart 5 - Contaminant Risks for Nitrates and/or Nitrites in Appendix D).

Nitrate levels are often derived from the decomposition of organic matter in soils. After combining the contaminant risk for nitrates and nitrites with the natural susceptibility of the well, the overall vulnerability of the well to nitrate and nitrite contamination is **Low**.

Volatile Organic Chemicals

The contaminant risk for volatile organic chemicals is **Very High**. The risk is primarily attributed to the presence of an airport, fuel tanks, and an ADEC recognized contaminated site and LUST site in Zones A, B, C, and D (see Table 4 – Appendix B).

No recent sampling data was available in ADEC records for Pacifica House & Diane's Restaurant (See Chart 7 – Contaminant Risks for Volatile Organic Chemicals in Appendix D).

After combining the contaminant risk for volatile organic chemicals with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Medium**.

Using the Source Water Assessment

This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of Pacifica House & Diane's Restaurant and the community of Bethel to protect public health. It is anticipated that Source Water Assessments will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of the drinking water source.


REFERENCES

- Alaska Department of Community and Economic Development (ADCED), 2003 [WWW document]. URL: http://www.dced.state.ak.us/cbd/commdb/CF_COMDB.htm
- Alaska Department of Environmental Conservation, Contaminated Sites Database, 2003 [WWW database], URL http://www.state.ak.us/dec/dspar/csites/cs search.htm
- Alaska Department of Environmental Conservation, Leaking Underground Storage Tank Database, 2003 [WWW database], URL http://www.dec.state.ak.us/spar/stp/ust/search/fac_search.asp
- Dames & Moore, 1996. Final Water and Sewer Facilities Master Plan Update Report, City of Bethel.
- Freeze, R. A., and Cherry, J.A. 1979, Groundwater, Prentice-Hall, Englewood Cliffs, New Jersey.
- United States Environmental Protection Agency (EPA), 2002 [WWW document]. URL http://www.epa.gov/safewater/mcl.html.

APPENDIX A

Drinking Water Protection Area Location Map (Map A)

Public Water Well System for PWS #271982.001 Pacifica House and Diane's Restaurant

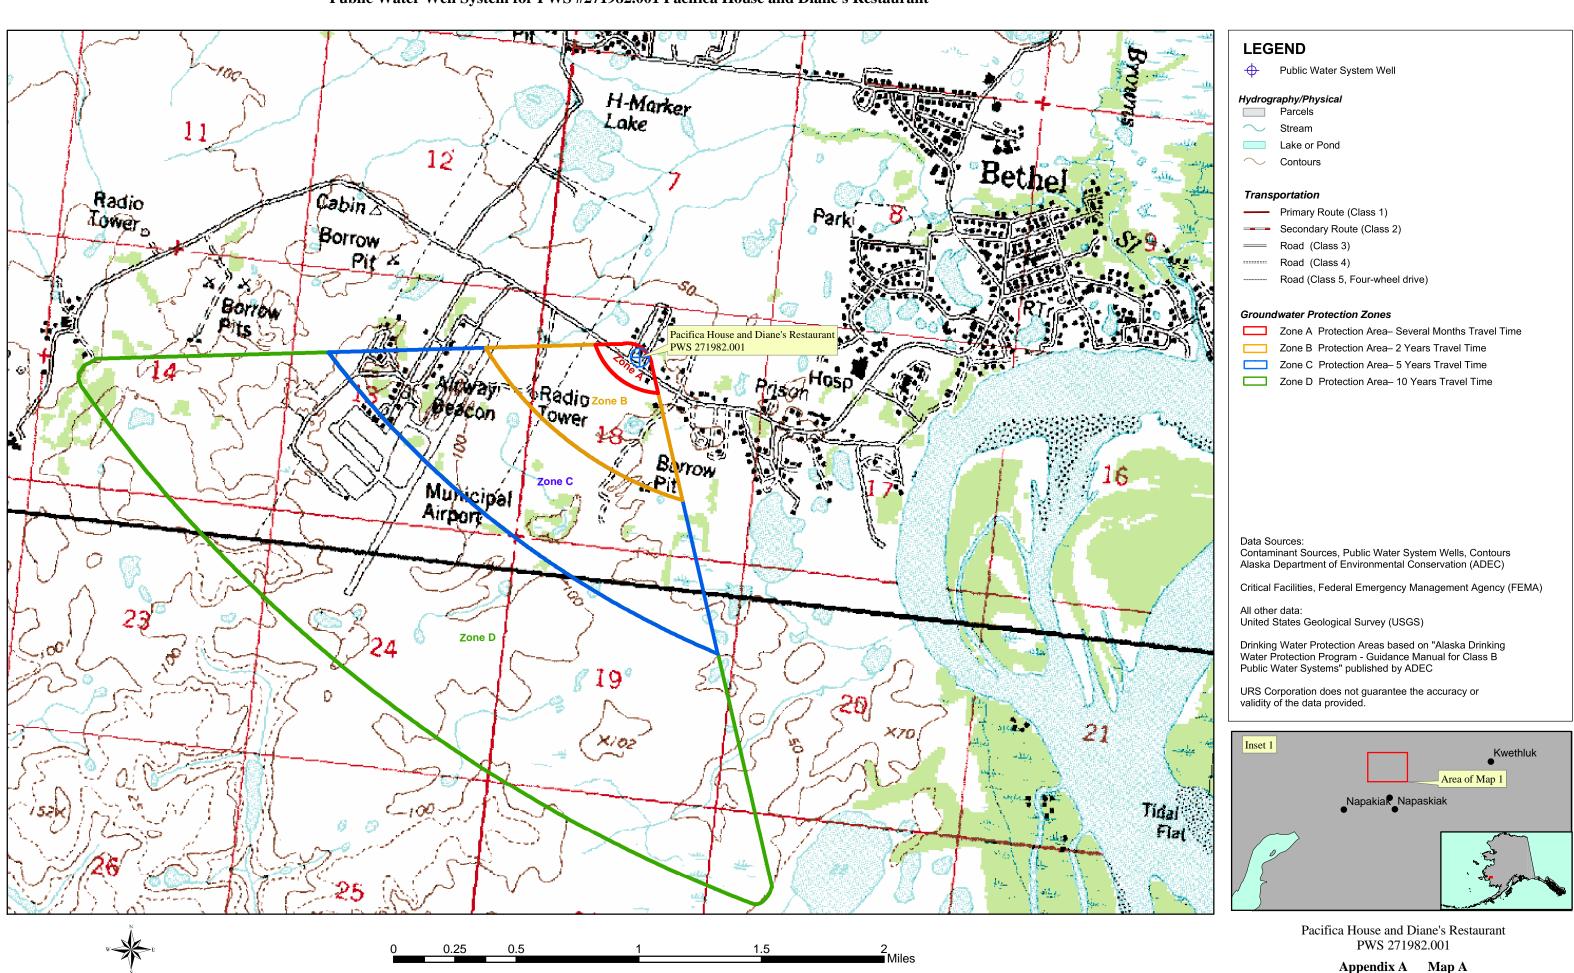

APPENDIX B

Contaminant Source Inventory and Risk Rankings (Tables 1-4)

Contaminant Source Inventory for Pacifica House and Diane's Restaurant

PWSID 271982.001

| Contaminant Source Type | Contaminant Source ID | CS ID tag | Zone | Map Number | Comments |
|---|--------------------------|-----------|------|------------|--|
| Domestic wastewater collection systems (sewer lines or lift stations) | D01 | D01-01 | A | С | |
| Tanks, gasoline (above ground) | T10 | T10-01 | A | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-01 | A | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-02 | A | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-03 | A | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-04 | A | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-05 | A | С | |
| Wastewater Holding Tank | T22 | T22-01 | A | С | |
| Water supply wells | W09 | W09-01 | A | С | 271981.001 FAA Bethel Well #1 (Zone C) |
| Glycol (disposal or storage) | X07 | X07-01 | A | С | |
| Airports | X14 | X14-01 | В | С | |
| Tanks, diesel (underground) | T08 | T08-01 | С | С | Diesel |
| Tanks, diesel (underground) | Т08 | T08-02 | С | С | Diesel |
| Tanks, diesel (underground) | Т08 | T08-03 | С | С | Diesel |
| Open Leaking Underground Fuel Storage Tank (LUST) Sites | U07 | U07-01 | С | С | FAA Bethel SFO, no additional information available through ADEC |
| Airports | X14 | X14-01 | С | С | |
| Landfills (industrial; type of industrial waste?) | D52 | D52-01 | D | С | Bethel White Alice |
| Contaminated sites, DEC recognized, non-Superfund, non-RCRA | U04 | U04-01 | D | С | ERA Bethel Airport Facility, RecKey #1996250121901, Status: Active, site soils extensively contaminated with diesel and gasoline range organics, unknown if groundwater is contaminated. |
| Airports | X14 | X14-01 | D | С | |

PWSID 271982.001

Table 2

Contaminant Source Inventory and Risk Ranking for Pacifica House and Diane's Restaurant Sources of Bacteria and Viruses

| Contaminant Source Type | Contaminant Source ID | CS ID tag | Zone | Risk Ranking for Analysis | Map Number | Comments |
|--|--------------------------|-----------|------|------------------------------|---------------|----------|
| Domestic wastewater collection systems (sewer line or lift stations) | D01 | D01-01 | A | Medium | С | |
| Wastewater Holding Tank | T22 | T22-01 | A | Low | С | |

Table 3

Contaminant Source Inventory and Risk Ranking for Pacifica House and Diane's Restaurant Sources of Nitrates/Nitrites

| Contaminant Source Type | Contaminant Source ID | CS ID tag | Zone | Risk Ranking for Analysis | Map Number | Comments |
|--|--------------------------|-----------|------|------------------------------|---------------|----------|
| Domestic wastewater collection systems (sewer line or lift stations) | D01 | D01-01 | A | Medium | С | |
| Wastewater Holding Tank | T22 | T22-01 | A | Low | C | |
| Airports | X14 | X14-01 | В | Low | С | |
| Airports | X14 | X14-01 | С | Low | С | |
| Airports | X14 | X14-01 | D | Low | С | |

Table 4


Contaminant Source Inventory and Risk Ranking for Pacifica House and Diane's Restaurant Sources of Volatile Organic Chemicals

| Contaminant Source Type | Contaminant Source ID | CS ID tag | Zone | Risk Ranking for Analysis | Map Number | Comments |
|--|--------------------------|-----------|------|---------------------------|---------------|--|
| Domestic wastewater collection systems (sewer line or lift stations) | D01 | D01-01 | A | Low | С | |
| Tanks, gasoline (above ground) | T10 | T10-01 | A | Medium | C | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-01 | A | Low | C | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-02 | A | Low | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-03 | A | Low | C | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-04 | A | Low | С | |
| Tanks, heating oil, nonresidential (aboveground) | T14 | T14-05 | A | Low | С | |
| Wastewater Holding Tank | T22 | T22-01 | A | Medium | С | |
| Airports | X14 | X14-01 | В | High | С | |
| Tanks, diesel (underground) | T08 | T08-01 | С | High | С | Diesel |
| Tanks, diesel (underground) | T08 | T08-02 | С | High | С | Diesel |
| Tanks, diesel (underground) | T08 | T08-03 | С | High | С | Diesel |
| Open Leaking Underground Fuel Storage Tank (LUST) Sites | U07 | U07-01 | С | High | С | FAA Bethel SFO, no additional information available through ADEC |
| Airports | X14 | X14-01 | С | High | С | |
| Contaminated sites, DEC recognized, non-Superfun non-RCRA | U04 | U04-01 | D | High | С | ERA Bethel Airport Facility, RecKey #1996250121901, Status: Active, si soils extensively contaminated with diesel and gasoline range organics, unknown if groundwater is contaminated. |
| Airports | X14 | X14-01 | D | High | С | |

APPENDIX C

Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map C)

Public Water Well System for PWS #271982.001 Pacifica House and Diane's Restaurant Showing Potential and Existing Sources of Contamination

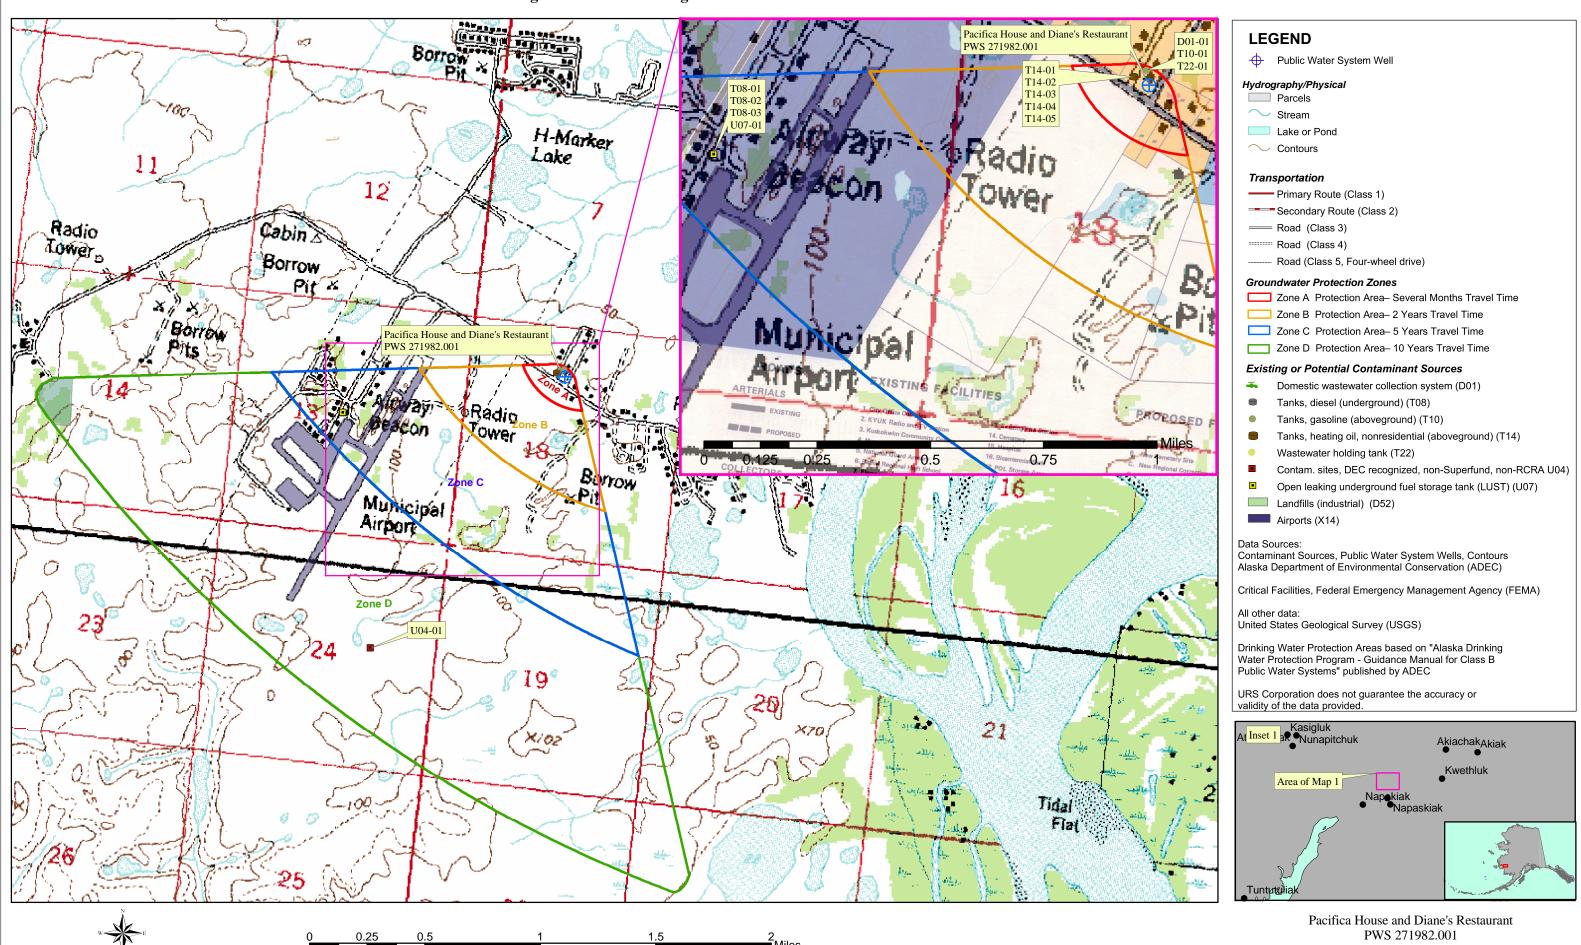

Appendix C Map C

APPENDIX D

Vulnerability Analysis for Public Drinking Water Source (Charts 1-8)

Susceptibility initially assumed to be low. Susceptibility of wellhead = 0 pts Is the well Increase susceptibility 5 pts + 0 pts properly grouted? Is the well Increase susceptibility 20 pts 0 pts capped? YES YES Susceptibility of wellhead Low 0 pts YES Increase susceptibility: Is the well 10 pts: suspected floodplain + 0 pts within a Wellhead Susceptibility Ratings 20 pts: known floodplain floodplain? 20 to 25 pts very high 15 to < 20 pts 10 to < 15 pts medium < 10 pts low Is the land Increase susceptibility 5 pts surface sloped 0 pts away from the

Chart 1. Susceptibility of the wellhead - Pacifica House & Diane's Restaurant (PWS No. 271982.001)

Chart 2. Susceptibility of the aquifer Pacifica House & Diane's Restaurant (PWS No. 271982.001)

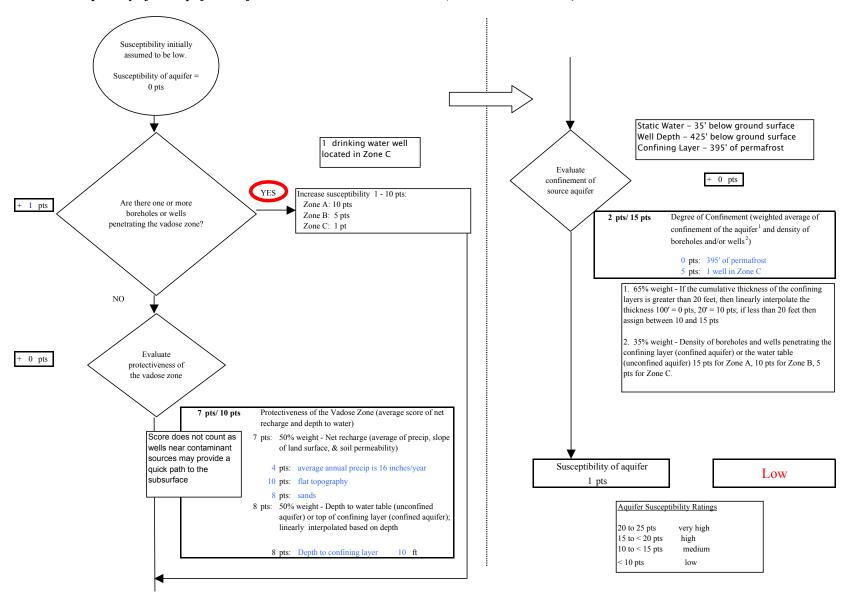


Chart 3. Contaminant risks for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Bacteria & Viruses

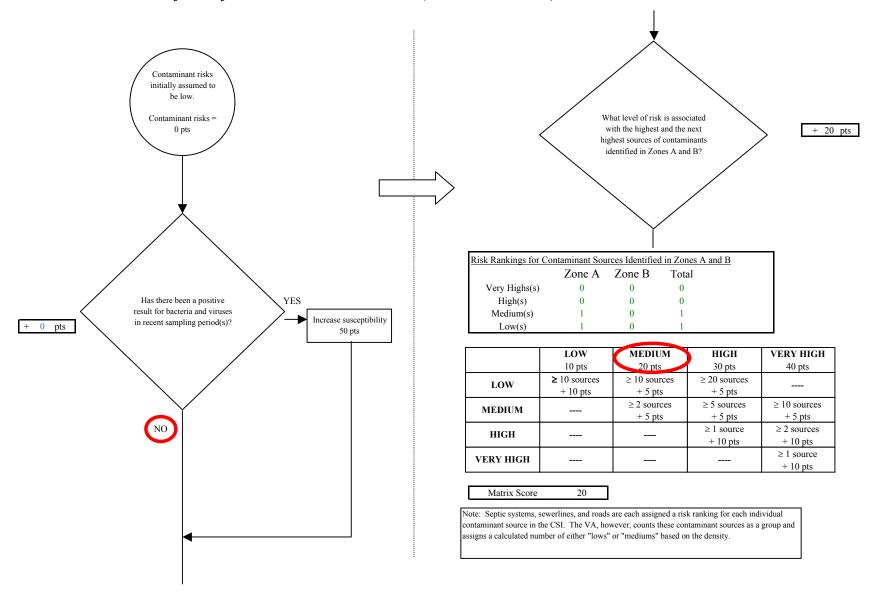


Chart 3. Contaminant risks for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Bacteria & Viruses NO Are there sufficient Initial assessment of risk posed by Risk unchanged controls, conditions, or potential sources of contamination monitoring to warrant = 20 pts downgrading risk? Are any YES significant Risk unchanged contaminant Reduce risk 1 - 10 pts sources within - 0 pts Zone A? The number and magnitude of Risk posed by potential sources of contaminant sources YES contamination with controls in Zone A 25 determines a risk 5 pts Increase risk 1 - 10 pts increase. See Table 2 for inventory. Existing Risk due to existing 0 pts contamination Are there any conditions that Risk unchanged Risk posed by potential sources warrant upgrading Potential of contamination with controls risk? 25 pts Contaminant risks Contaminant Risk YES 25 pts Increase risk 1 - 10 pts + 0 pts Contaminant risks* * Truncate risk at 50 pts 25 Contaminant Risk Ratings Risk posed by potential sources of contamination 40 to 50 pts very high = 25 30 to < 40 pts high Medium $20 \text{ to} \le 30 \text{ pts}$

Page 4 of 13


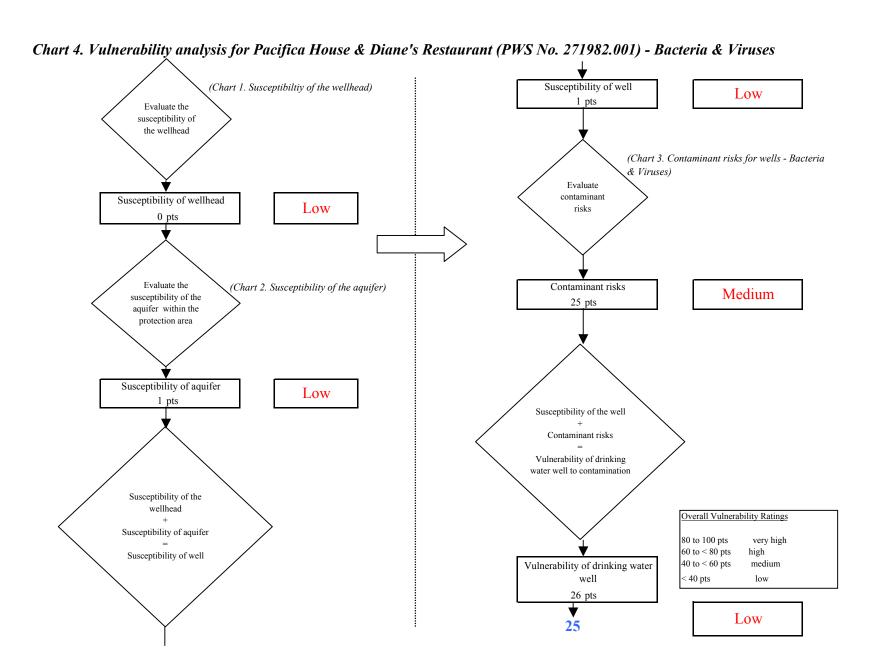


Chart 5. Contaminant risks for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Nitrates and Nitrites Contaminant risks initially assumed to be low. Current level of Evaluate the level of Contaminant risks background contamination due to man-= 0 ptscontamination from made source(s) natural sources 0 pts Is the concentration of NO Has nitrates and/or the contaminant nitrites been detected in increasing, decreasing, the source waters in or staying the same? recent sampling period(s)? Recent Nitrate Sampling Results (mg/L) 8/1/2000 The nitrate concentration is assumed to be natural if less than 2 mg/L (20%), or Increasing: risk up 1 - 10 pts attributed to man made YES Decreasing: risk down 1 - 5 pts sources if greater than 2 + 0 pts Same: risk unchanged mg/L. Maximum Contaminant Level (MCL) = 10 mg/LDetected Nitrate Level = Existing contamination points based on Risk due to existing man-Risk due to natural linear interpolation of most recent detect sources made sources [MCL = 50 pts; detect = 0 pts]0 pts Risk due to existing contamination 0 pts Was the source of Evaluate the level of NO. contamination contamination from natural? man-made sources YES

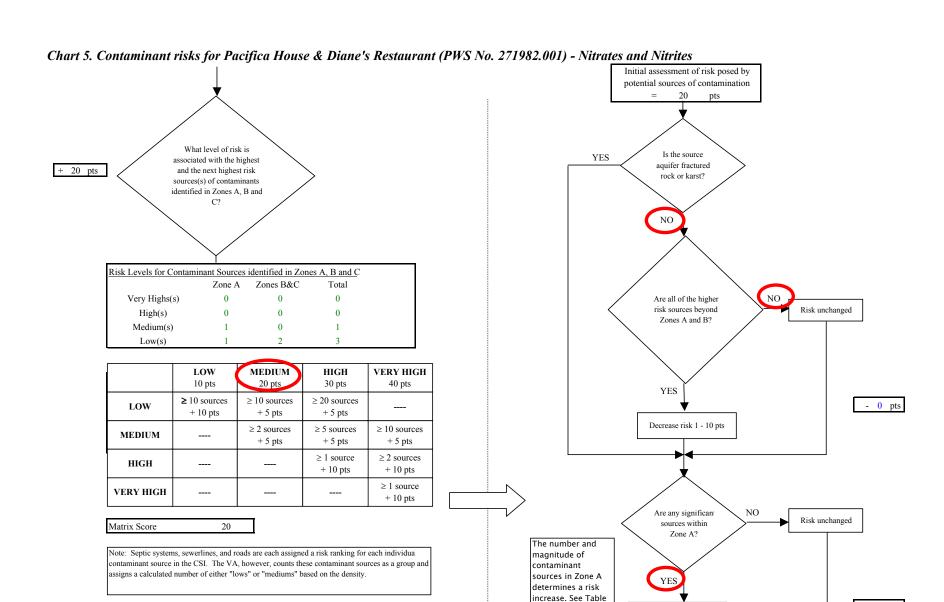

3 for inventory.

Increase risk 1 - 10 pts

+ 5 pts

Chart 5. Contaminant risks for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Nitrates and Nitrites Existing NO Are there conditions 0 pts Risk unchanged that warrant upgrading risk? Risk due to existing Potential contamination 25 pts Risk posed by potential sources of contamination with controls Contaminant Risk YES 25 pts Contaminant risks 0 pts Increase risk 1 - 10 pts Risk posed by potential sources of contamination 25 pts *Truncate risk at 50 pts Contaminant risks* 25 Are there sufficient Contaminant Risk Ratings Medium controls, conditions, NO. Risk unchanged or monitoring to 40 to 50 pts very high warrant downgrading 30 to < 40 pts high 20 to < 30 pts risk? medium < 20 pts low YES 0 pts Decrease risk 1 - 10 pts Risk posed by potential sources of contamination with controls

Page 8 of 13

(Chart 1. Susceptibiltiy of the wellhead) Susceptibility of well Low Evaluate the susceptibility of the wellhead (Chart 5. Contaminant risks for wells - Nitrates and Nitrites) Evaluate Susceptibility of wellhead contaminant risks Low 0 pts Evaluate the (Chart 2. Susceptibility of the aquifer) Contaminant risks Medium susceptibility of the 25 pts aquifer within the protection area Susceptibility of aquifer Low 1 pts Susceptibility of the well Contaminant risks Vulnerability of drinking water well to contamination Susceptibility of the wellhead Overall Vulnerability Ratings Susceptibility of aquifer 80 to 100 pts very high Susceptibility of well 60 to < 80 pts high 40 to < 60 pts medium Vulnerability of drinking water well < 40 pts 26 pts Low **25**

Chart 6. Vulnerability analysis for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Nitrates and Nitrites

Chart 7. Contaminant risks for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Volatile Organic Chemicals Contaminant risks initially assumed to be low. Current level of Evaluate the level of Contaminant risks background contamination due to man-= 0 ptscontamination from made source(s) natural sources NO or Is the concentration of Have volatile organic UNKNOWN the contaminant chemicals been detected increasing, decreasing, in the source waters in or staying the same? recent sampling Recent VOC Sampling period(s)? Results (mg/L) No recent VOC sampling data was available in ADEC records for this Increasing: risk up 1 - 10 pts PWSID YES Decreasing: risk down 1 - 5 pts + 0 pts Same: risk unchanged Existing contamination points based on Risk due to existing man-Risk due to natural linear interpolation of most recent detect made sources sources [MCL = 50 pts; detect = 0 pts]0 pts Risk due to existing contamination 0 pts Was the source of Evaluate the level of NO. contamination contamination from natural? man-made sources YES

Page 10 of 13

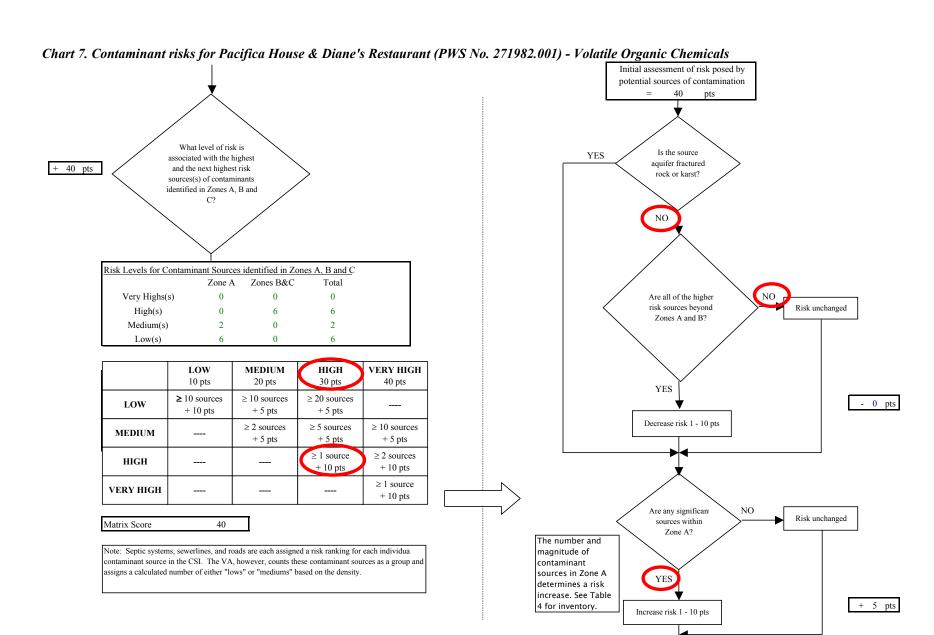


Chart 7. Contaminant risks for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Volatile Organic Chemicals Existing NO Are there conditions 0 pts Risk unchanged that warrant upgrading risk? Risk due to existing Potential contamination The number and 47 pts magnitude of Risk posed by potential sources contaminant of contamination with controls Contaminant Risk sources in Zone D YES determines a risk 47 pts Contaminant risks increase. See Table 4 for inventory. 2 pts Increase risk 1 - 10 pts Risk posed by potential sources of contamination 47 pts *Truncate risk at 50 pts Contaminant risks* 47 Contaminant Risk Ratings Are there sufficient Very High controls, conditions, NO. Risk unchanged or monitoring to 40 to 50 pts very high warrant downgrading 30 to < 40 pts high 20 to < 30 pts risk? medium < 20 pts low YES 0 pts Decrease risk 1 - 10 pts Risk posed by potential sources of contamination with controls

Page 12 of 13

Chart 8. Vulnerability analysis for Pacifica House & Diane's Restaurant (PWS No. 271982.001) - Volatile Organic Chemicals (Chart 1. Susceptibiltiy of the wellhead) Susceptibility of well Low Evaluate the susceptibility of the wellhead (Chart 7. Contaminant risks for wells - Volatile Organic Chemicals) Evaluate Susceptibility of wellhead contaminant risks Low 0 pts Evaluate the (Chart 2. Susceptibility of the aquifer) Contaminant risks Very High susceptibility of the 47 pts aquifer within the protection area Susceptibility of aquifer Low 1 pts Susceptibility of the well Contaminant risks Vulnerability of drinking water well to contamination Susceptibility of the wellhead Overall Vulnerability Ratings Susceptibility of aquifer 80 to 100 pts very high Susceptibility of well 60 to < 80 pts high 40 to < 60 pts medium Vulnerability of drinking water well < 40 pts 48 pts Medium **50**